

8404270086 840423
PDR ADCK 05000302
S PDR

SUPPLEMENTARY INFORMATION

REPORT NO.: 50-302/83-056/03X-1

FACILITY: Crystal River Unit 3

REPORT DATE: April 23, 1984

OCCURRENCE DATE: November 22, 1983

IDENTIFICATION OF OCCURRENCE:

One steam generator emergency feedwater pump (EFP-2) was inoperable, required by Technical Specification 3.7.1.2.

CONDITIONS PRIOR TO OCCURRENCE:

Mode 1, 100% Full Power

DESCRIPTION OF OCCURRENCE:

At 1000 on November 22, 1983, while performing Surveillance Procedure SP-349B, Emergency Feedwater System Operability Demonstration, the governor on Emergency Feedwater Pump (EFP-2) was discovered to be set incorrectly. The control knob was adjusted to the proper setting and the surveillance testing continued.

DESIGNATION OF APPARENT CAUSE:

The setting of the EFP-2 governor was inadvertently changed.

ANALYSIS OF OCCURRENCE:


Emergency Feedwater Pump 1 (EFP-1) was operable and available to provide emergency feedwater, if necessary.

CORRECTIVE ACTION:

Surveillance Procedure SP-300, Operating Daily Surveillance Log, was revised to require checking the governor setting on a daily basis to assure the proper setting is maintained. A locking cover was installed over the control knob to prevent recurrence.

FAILURE DATA:

This is the first occurrence of EFP-2 governor inoperability and the twenty-fifth report under Technical Specification 3.7.1.2.

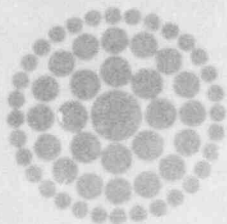

**Florida
Power**
CORPORATION

April 23, 1984
3F0484-18

Document Control Desk
U.S. Nuclear Regulatory Commission
Washington, DC 20555

Subject: Crystal River Unit 3
Docket No. 50-302
Operating License No. DPR-72
Licensee Event Report No. 83-056, Rev. 1

Dear Sir:

Enclosed is Revision 1 to Licensee Event Report No. 83-056.

Should there be any questions, please contact this office.

Sincerely,

G. R. Westafer
Manager, Nuclear Operations
Licensing and Fuel Management

AEF/feb

Enclosure

cc: Mr. James P. O'Reilly
Regional Administrator, Region II
Office of Inspection & Enforcement
U.S. Nuclear Regulatory Commission
101 Marietta Street N.W., Suite 2900
Atlanta, GA 30303

LE 22
1/1