

Commonwealth Edison
Quad-Cities Generating Station
Post Office Box 216
Cordova, Illinois 61242
Telephone 309/654-2241

NJK-75-156

Telecopy: Region III, Attention: Mr. C. Feierabend

March 26, 1975

J. Keppler, Regional Director
Directorate of Regulatory Operations
Region III
U. S. Nuclear Regulatory Commission
799 Roosevelt Road
Glen Ellyn, Illinois 60137

Reference: Quad-Cities Nuclear Power Station, Unit 2
Docket No. 50-265, DPR-30
Appendix A, Sections 1.0.A.2, Table 3.7.1

Dear Mr. Keppler:

The purpose of this letter is to provide you with notification of an Abnormal Occurrence as required by Technical Specification 6.6.B.1.a within 24 hours of the occurrence.

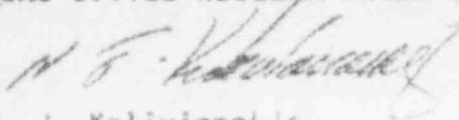
At 4:00 a.m. on March 26, 1975, with Unit 2 in the cold shutdown condition for refueling, surveillance testing of the primary containment isolation valves in the pressure suppression system revealed that valve AO 2-1601-63 would not close, and valves AO 2-1601-23 and AO 2-1601-56 took 17.2 seconds and 14.1 seconds to close respectively. This was in violation of closing time requirements (≤ 10 seconds) in Table 3.7.1 of Technical Specifications.

The solenoid was replaced for valve AO 2-1601-63 and the valve was closed successfully in 4.2 seconds. The air bleed-offs were readjusted on valves AO 2-1601-23 and AO 2-1601-56. The valves were then retimed at 7 seconds and 6.8 seconds respectively. All repairs and retesting were completed on the same day as that of the occurrence.

This occurrence was discussed by telephone with Mr. Feierabend of your office on March 26, 1975. Further information will be provided by Abnormal Occurrence Report AO 50-265/75-10 which will be submitted within 10 days of the date of this occurrence.

Very truly yours,

COMMONWEALTH EDISON COMPANY
QUAD-CITIES NUCLEAR POWER STATION


N. J. Kalivianakis
Station Superintendent

NJK/SRM/jel

8306270114 750405
PDR APPROV. OF