



UNITED STATES
NUCLEAR REGULATORY COMMISSION
WASHINGTON, D. C. 20555

Docket No. 50-289

JUL 24 1984

MEMORANDUM FOR: H. Denton R. Vollmer
E. Case D. Muller
G. Edison H. Thompson
D. Eisenhut B. Snyder
F. Miraglia G. Holahan
G. Lainas S. Varga
T. Novak D. Vassallo
D. Crutchfield J. Miller
T. Speis

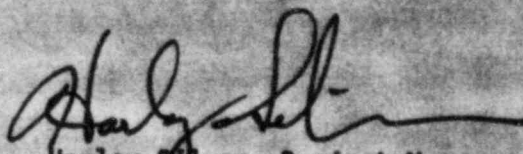
THRU: John F. Stolz, Chief, Operating Reactors Branch #4
Division of Licensing

FROM: ~~Harley Silver~~, Project Manager
Operating Reactors Branch #4, Division of Licensing

SUBJECT: DAILY HIGHLIGHT STEAM GENERATOR TUBE PLUGS

Investigation by the licensee into the recent minor steam generator leakage has uncovered tube plugging problems, as follows:

1. One tube was not plugged in the upper tube sheet (UTS) although it should have been. This has been corrected.
2. One welded plug in OTSG "A" UTS was supposedly dislodged and "relocated" to another tube. The plug was removed from its new location and the original tube was replugged.
3. Three rolled plugs from "A" OTSG and two from "B" OTSG were found to be missing from the lower tube sheet (LTS). These plugs are probably in the reactor vessel. There are approximately 490 tubes which have been plugged using these Westinghouse rolled plugs. The licensee is investigating the cause of this problem and the action they propose be taken.


Harley Silver, Project Manager
Operating Reactors Branch #4
Division of Licensing

8506140110 850125
PDR FOIA
DETJEN84-897 PDR

Document Release Form

(Refer to EMP-008)

Date 8/11/84

Page 1 of

| | | |
|---------------------|---|---|
| To <u>JV Colitz</u> | Release Action | |
| | <input type="checkbox"/> Review/Comment <input type="checkbox"/> As-Built <input type="checkbox"/> Record | <input type="checkbox"/> Construction <input type="checkbox"/> Procurement <input checked="" type="checkbox"/> Operations/Maintenance <input type="checkbox"/> Hold Construction |

| | | |
|---------------------------|---------------------------------|------------------|
| Originator <u>BD Elam</u> | Home Base <u>5310</u> | Tel. <u>2306</u> |
| Unit <u>TMI-1</u> | Budget Activity # <u>115302</u> | WO/SO # _____ |

| List of Released Items | | | | |
|------------------------|----------------|-------|------|--|
| Company | Document No. | Sheet | Rev. | Title |
| GPUN | SP-1101-22-019 | | 0 | OTSG Westinghouse Rolled Plug Pull Testing |

Special Instructions

References/Attachments

Approved B. Elam Date 8/11/84 197