

February 12, 1997

Richard Lange, Senior Vice President
UNC, Inc.
175 Admiral Cochrane Drive
Annapolis, MD 21401

SUBJECT: INSPECTION NO. 070-00371/97-001

Dear Mr. Lange:

On September 16-17, 1996, Marie Miller of this office and staff of the Oak Ridge Institute for Science and Education (ORISE) conducted a special safety inspection at 71 Shelton Avenue, New Haven, Connecticut (formerly identified as buildings 3H and 6H for activities previously authorized by NRC License No. SNM-368, last held by United Nuclear Corporation) to determine the current radiological status of the facility. A representative from the State of Connecticut Department of Environmental Protection (CT DEP) also participated in the inspection.

The inspection consisted of a scoping survey conducted by ORISE, which included document and data reviews; gamma surface scans; beta scans of drain openings; subfloor soil sampling; pipe trench residue sampling; and storm/sewer system sediment sampling. A copy of the NRC inspection report, which attaches the ORISE scoping survey is enclosed. The findings of the inspection were discussed during a telephone conversation on February 4, 1997, between you and Marie Miller and myself.

During this telephone discussion, you stated that UNC, Inc., is the parent company of United Nuclear Corporation, which is a shell company with no assets. Further you indicated that UNC, Inc. did not exist in 1976, at the time the New Haven facility was released for unrestricted use and removed as a location of use on NRC License No. SNM-368 by NRC. Therefore, you stated that you believe that UNC, Inc. is not the responsible party to address the residual contamination that was identified during a reexamination of the termination of the New Haven facility location. We have considered your statements, and conclude that as the existing parent company of United Nuclear Corporation, that UNC, Inc. is the successor for United Nuclear Corporation. Therefore, we are contacting UNC, Inc., to address these contamination issues.

Although no violations were identified within the scope of this inspection, the results of this inspection report and NRC Inspection Report 070-00371/96-001, dated July 26, 1996, indicate that the facility continues to have areas that are contaminated with enriched uranium above current NRC release guidelines. We recognize that the current soil release guideline of 30 picocuries enriched uranium per gram of soil/sediment was not implemented by United Nuclear Corporation at the time that NRC granted the

RETURN ORIGINAL TO
REGION I

OFFICIAL RECORD COPY

IE:07

9702200260 970212
PDR ADDCK 07000371
C PDR

R. Lange
UNC, Inc.

-2-

license amendment request to release the H-tract buildings for unrestricted use by the public; and that there is not an immediate health and safety hazard with respect to the soil and sediment contamination. Nevertheless, we request that UNC, Inc., as the parent company for the previous licensee and owner of Buildings 3H and 6H, provide NRC your plans to further characterize the areas where enriched uranium was identified above 30 picocuries/gram.

We believe it would be beneficial to conduct a meeting to discuss your characterization proposal to facilitate timely resolution of this matter. Please contact either Marie Miller at 610-337-5205 or myself at 610-337-5200 within 30 days of receipt of this letter to discuss arrangements for a meeting.

In accordance with Section 2.790 of the NRC's "Rules of Practice," Part 2, Title 10, Code of Federal Regulations, a copy of this letter will be placed in the Public Document Room.

Your cooperation with us is appreciated.

Sincerely,

Original Signed By:
Ronald R. Bellamy

Ronald R. Bellamy, Chief
Decommissioning and Laboratory Branch
Division of Nuclear Materials Safety

Docket No.: 070-00371
License No.: SNM-368

Enclosure:
Inspection Report No. 070-00371/97-001
cc w/enclosure:
Robert F. Bonito, General Manager
UNC, Inc., Naval Products Division
P.O. Box 981
Uncasville, CT 06382-0981

Kevin McCarthy, Director
Monitoring and Radiation
State of Connecticut
Department of Environmental Protection
79 Elm Street
Hartford, CT 06106-5127

OFFICIAL RECORD COPY

R. Lange
UNC, Inc.

-3-

Alan Jarman, Property Manager
71 Shelton Avenue
P.O. Box 8538
New Haven, Ct 06531

David C. Driver, President & CEO
Science Park Development Corporation
5 Science Park South, Box 35
New Haven, CT 06511

Raymond Smedberg, General Manager
Water Pollution Control Authority
345 East Shore Parkway
New Haven, CT 06512

R. Lange
UNC, Inc.

-4-

Distribution: w/encl

PUBLIC

Nuclear Safety Information Center (NSIC)

Region I Docket Room (w/concurrences)

J. Hickey, NMSS

B. Fewell, RI

D. Chawaga, RI

DOCUMENT NAME: S:UNC.971S:\UNC.971S:\UNC.971

To receive a copy of this document, indicate in the box: "C" = Copy w/o attach/encl "E" = Copy w/ attach/encl "N" = No copy

OFFICE	DNMS/RI	<input checked="" type="checkbox"/>	DNMS/RI	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
NAME	MMiller	<i>MM</i>	RBellamy	<i>RB</i>			
DATE	02/11/97		02/11/97		02/ /97		02/ /97

OFFICIAL RECORD COPY

U.S. NUCLEAR REGULATORY COMMISSION
REGION I

INSPECTION REPORT

Report No. 070-00371-97-001

Docket No. 070-00371

License No. SNM-368 (Terminated)

Licensee: Former United Nuclear Corporation

Facility Name: 71 Shelton Avenue (Formerly Buildings 3H & 6H)

Inspection At: 71 Shelton Avenue
New Haven, CT 06531

Inspection Conducted: September 16-17, 1996

Inspectors: Marie Miller 2-11-1997
Marie Miller, Senior Health Physicist date

Jim Payne, Senior Health Physics Technician, ORISE
Lea Mashburn, Health Physics Technician, ORISE
Kevin Scott, Radiation Control Physicist, CT DEP

Approved By: Ronald R. Bellamy Feb 12, 1997
Ronald R. Bellamy, Chief, date
Decommissioning and Laboratory Branch
Division of Nuclear Materials Safety

Inspection Summary: Announced scoping survey of the facility for residual contamination on September 16-17, 1997. (Inspection Report No. 070-00371-97-001)

Areas Inspected: ORISE Radiological Scoping Survey

Results: All building surface contamination levels were below the NRC criteria for release for unrestricted use in the facility. However, soil and sediment samples from areas below concrete flooring, and in an open trench and the previous liquid effluent discharge sewer pipe, indicated enriched uranium contamination in excess of the current NRC guideline for enriched uranium of 30 picocuries/gram. The level of enrichment, identified by alpha spectrometry also indicates that the one surface soil sample reported in NRC Inspection Report 070-00371/96-001 is also above the 30

Inspection Report No. 070-00371-97-001

picocuries/gram. These results indicate no immediate public health and safety concern, however, additional characterization of these areas by the previous NRC licensee are needed. The results of further characterization would determine the extent of remediation to be taken by the previous licensee.

DETAILS1. Persons Contacted

A. Jarman, Property Manager, 71 Shelton Avenue
T. Stabell, Manager, Science Park Development Corporation
R. Bonito, General Manager, UNC, Inc., Naval Products Division
R. Smedberg, General Manager, New Haven Water Pollution Control Authority
H. Goetz, New Haven City Engineering Department
K. McCarthy, Director, Monitoring and Radiation, CT DEP

2. Background

As part of the Nuclear Regulatory Commission program to ensure that licenses that were terminated after 1965 meet the NRC's current criteria for release for unrestricted use, the NRC's contractor, Oak Ridge National Laboratory (ORNL), identified License SNM-368 as a file describing a site that required additional review. NRC Region I staff reviewed this file, including the February 26, 1976 final survey report for the H-tract, and determined that further information on this site was necessary to conclude that the buildings and property meet the current criteria for release for unrestricted use.

United Nuclear Corporation, New Haven, CT, originally belonged to Olin Mattieson Chemical Corporation - Winchester Western Division. Olin operated as a contractor from 1956 to 1960, and obtained an AEC (later NRC) license SNM-368 (Docket No. 070-00371) in October 1960 for fabrication and manufacture of reactor fuel. Licensed activities were authorized in a total of 11 buildings, known as the H-tract. Some of these buildings date back to 1914 from the Winchester Corporation. On May 31, 1961, Olin transferred these assets to United Nuclear-Fuels Division. On June 8, 1961, NRC re-issued SNM-368 to United Nuclear-Fuels Division (later United Nuclear Corporation).

United Nuclear Corporation announced the closing of the New Haven operations and removed its inventory throughout September 1974. (Operations were to continue at the Montville, CT facility.) United Nuclear Corporation submitted its Final Survey Report of its H-tract buildings, and NRC conducted a confirmatory survey on March 8-10, 1976. By letter dated April 22, 1976, NRC amended SNM-368 to remove the H-tract buildings from the license, which included buildings 3H and 6H.

On May 29, 1996, an NRC Region I inspector conducted a scoping survey of 3H and 6H, with permission from the current non-NRC licensed owners and participation from UNC, Inc., Naval Products representatives and CT DEP representatives. Alpha/beta and gamma scanning did not identify any areas above the exposure rate and fixed contamination guidelines. At the request of the NRC

inspector for any additional environmental sampling data, a UNC, Inc., representative provided both final data and draft data for soil concentration results that had not been previously forwarded to the NRC. (The licensee's final survey report in 1976 had indicated that the analyses were to be submitted when received from the vendor.) These results indicated surface and sub-surface soil concentrations of enriched uranium in the range of 30 to 700 picocuries per gram (pCi/g). These values are in excess of the NRC current guideline of 30 pCi/g of enriched uranium in soil. Further, the sewer system that had received liquid radioactive effluents had not been sampled previously, and was inaccessible to the NRC inspector during the May 1996 inspection.

Based on these preliminary measurements and the lack of sample data for the liquid effluent release pathway, NRC arranged for ORISE to conduct another scoping survey including sewer and core-borings. Access to the buildings was arranged through the current property owner representative and also through the New Haven Water Pollution Control Authority. During the inspection, permission was also received to sample the sediments in the sewer pipe, which was under the authority of Science Park Development Corporation.

3. Site Survey

The address currently designated as 71 Shelton Avenue is the former location of United Nuclear Corporation buildings 3H and 6H. A fence encloses a large one story warehouse with a few areas of soil and vegetation located close to the building.

The facility area layout, areas sampled, survey procedures and survey results are detailed in the attached ORISE Report.

4. Results

Results of the ORISE survey identified enriched uranium in below-surface soils (0 to 45 cm) and sediments from the sewer line that received liquid radioactive effluents. Concentrations above the release criteria of 30 pCi/g total enriched uranium varied from 37 to 723 pCi/g.

The ORISE alpha spectrometry analyses also confirmed that the material was highly enriched. This information was not considered when interpreting the one soil sample result, taken under a pile of rubble near the entrance to Building 3H during the May 1996 scoping survey. As documented in NRC Inspection Report 070-00371/96-001, dated July 26, 1996, the conclusion was drawn that the soil contained a total uranium concentration below the 30 pCi/g release criteria. However, this conclusion did not account for the U-234 contribution, which should have been added for a total enriched uranium contribution. By applying the U-234 to U-235 ratio of 27, as reported by ORISE, the total uranium contribution was 97.5 pCi/g, rather than 3.61 pCi/g.

These below surface and surface soil results substantiated the data provided by UNC, Inc., during the May 1996 scoping survey.

Based on these results, no immediate safety concern was identified. However, additional characterization of the sewer line and onsite surface soils is needed. With respect to the below surface soil contamination, a risk assessment based on the below surface soil sampling data could be used to determine worker exposure during reuse of buildings or during demolition of buildings and concrete flooring. Decisions on remediation would follow these activities.

5. Exit Interview

The results of the inspection were discussed during four separate telephone conversations: between NRC and Mr. Lange on February 4, 1997; with Ms. Cunningham, Executive Assistant for Science Park Development Corporation on February 10, 1997; and with Mr. Jarman, and Mr. Smedberg on February 11, 1997.

**RADIOLOGICAL SCOPING SURVEY
OF BUILDINGS 3H AND 6H
AT THE
FORMER UNC H-TRACT FACILITY
NEW HAVEN, CONNECTICUT
[DOCKET 70-371]**

J.L. PAYNE

Prepared for the
U.S. Nuclear Regulatory Commission
Region I Office



O R I S E

OAK RIDGE INSTITUTE FOR SCIENCE AND EDUCATION

Environmental Survey and Site Assessment Program
Environmental and Health Sciences Division

**RADIOLOGICAL SCOPING SURVEY
OF BUILDINGS 3H AND 6H
AT THE
FORMER UNC H-TRACT FACILITY
NEW HAVEN, CONNECTICUT**

Prepared by

J. L. Payne

Environmental Survey and Site Assessment Program
Environmental and Health Sciences Division
Oak Ridge Institute for Science and Education
Oak Ridge, Tennessee 37831-0117

Prepared for the

U.S. Nuclear Regulatory Commission
Region I Office

FINAL REPORT

JANUARY 1997

This report is based on work performed under an Interagency Agreement (NRC FIN. No. A-9093) between the U.S. Nuclear Regulatory Commission and the U.S. Department of Energy. Oak Ridge Institute for Science and Education performs complementary work under contract number DE-AC05-76OR00033 with the U.S. Department of Energy.

**RADIOLOGICAL SCOPING SURVEY
OF BUILDINGS 3H AND 6H
AT THE
FORMER UNC H-TRACT FACILITY
NEW HAVEN, CONNECTICUT**

Prepared by: James L. Payne Date: 1/20/97
J. L. Payne, Health Physics Technician
Environmental Survey and Site Assessment Program

Reviewed by: T. J. Vitkus Date: 1/21/97
T. J. Vitkus, Survey Projects Manager
Environmental Survey and Site Assessment Program

Reviewed by: R. Dale Condra Date: 1/27/97
R. D. Condra, Technical Resources Manager
Environmental Survey and Site Assessment Program

Reviewed by: A. T. Payne Date: 1/27/97
A. T. Payne, Administrative Services Manager
Quality Assurance/Health & Safety Manager
Environmental Survey and Site Assessment Program

Reviewed by: E. W. Abelquist Date: 1/27/97
E. W. Abelquist, Assistant Program Director
Environmental Survey and Site Assessment Program

Reviewed by: W. L. Beck Date: 1/27/97
W. L. Beck, Program Director
Environmental Survey and Site Assessment Program

ACKNOWLEDGMENTS

The author would like to acknowledge the significant contributions of the following staff members:

FIELD STAFF

A. L. Mashburn

LABORATORY STAFF

R. D. Condra

J. S. Cox

M. J. Laudeman

S. T. Shipley

CLERICAL STAFF

D. K. Ash

T. S. Fox

K. E. Waters

ILLUSTRATORS

T. L. Bright

T. D. Herrera

TABLE OF CONTENTS

	<u>PAGE</u>
List of Figures	ii
List of Tables	iii
Abbreviations and Acronyms	iv
Introduction and Site History	1
Site Description	2
Objectives	3
Procedures	3
Findings and Results	5
Comparison of Results with Guidelines	6
Summary	7
References	14
Appendices:	
Appendix A: Major Instrumentation	
Appendix B: Survey and Analytical Procedures	
Appendix C: Guidelines for Residual Concentrations of Thorium and Uranium Wastes in Soil	

LIST OF FIGURES

	<u>PAGE</u>
FIGURE 1: New Haven, Connecticut—Location of Science Park	8
FIGURE 2: Layout of Science Park—Location of Buildings 3H and 6H	9
FIGURE 3: Floor Plan of Buildings 3H and 6H—Sampling Locations	10
FIGURE 4: Layout of Storm/Sewer System—Sampling Locations	11

LIST OF TABLES

	<u>PAGE</u>
TABLE 1: Radionuclide Concentrations in Subfloor Soil Samples	12
TABLE 2: Radionuclide Concentrations in Miscellaneous Samples	13

ABBREVIATIONS AND ACRONYMS

AEC	Atomic Energy Commission
ASME	American Society of Mechanical Engineers
Bkg	background
cm	centimeter
DOE	U.S. Department of Energy
EML	Environmental Measurements Laboratory
EPA	Environmental Protection Agency
ESSAP	Environmental Survey and Site Assessment Program
GM	Geiger-Mueller
kg	kilogram
MDC	minimum detectable concentration
MeV	million electron volts
NaI	sodium iodide
NIST	National Institute of Standards and Technology
NRC	U.S. Nuclear Regulatory Commission
ORISE	Oak Ridge Institute for Science and Education
ORNL	Oak Ridge National Laboratory
pCi/g	picocuries per gram
UNC	United Nuclear Corporation

**RADIOLOGICAL SCOPING SURVEY
OF BUILDINGS 3H AND 6H
AT THE
FORMER UNC H-TRACT FACILITY
NEW HAVEN, CONNECTICUT**

INTRODUCTION AND SITE HISTORY

United Nuclear Corporation (UNC) Naval Products Division fabricated reactor fuel elements for the Naval Reactors Program at the New Haven, Connecticut H-Tract facility under U.S. Nuclear Regulatory Commission (NRC) Docket No. 70-371, License No. SNM-368. The Atomic Energy Commission (AEC) issued the special nuclear material license to Olin Mathieson Corporation in 1959, which was later transferred to UNC in 1961. This license authorized possession and use of enriched uranium and later source materials, including natural uranium, depleted uranium, and thorium for research and nuclear fuel fabrication (NRC 1996).

Manufacturing activities at the H-Tract facility involved the fabrication of fuel elements which were then shipped to another site for upgrading into naval reactor components. The radioactive material used in these operations was primarily enriched and natural uranium. The H-Tract production facility received enriched uranium and combined it with zirconium to form fuel elements suitable for upgrading into fuel assemblies. All work involving unclad uranium fuel was performed in radiologically controlled areas.

Decontamination, the final licensee survey, and confirmatory activities have been completed at the UNC, Naval Products Division H-Tract facility. The structures that were remediated within this tract included Buildings 3H, 6H through 11H, 14H, and 44H. Facility decontamination was conducted in three phases involving the removal and disposal of radioactive waste and removal of the following equipment systems: 1) exhaust ducting, blowers, filters, hoods, furniture, process equipment, drop ceilings, floor tiles, and flooring; 2) sumps, drains, and pipes feeding the Rad Waste System and; 3) the Rad Waste System. Final survey activities were completed in 1976 and results indicated that the release criteria at the time were satisfied and the license was terminated (UNC 1976). However,

1976 soil sample data from areas below concrete flooring—but not provided to the NRC until May 29, 1996—indicated enriched uranium soil contamination ranging from 30 to 700 pCi/g within the decontamination pit and hot waste pipe trenches (NRC 1996).

The NRC has initiated a program to ensure that licenses for facilities, where activities authorized by the AEC and/or the NRC were conducted, have been terminated in accordance with the NRC's current criteria for release for unrestricted use. As part of this program, the NRC's contractor, Oak Ridge National Laboratory (ORNL), identified License No. SNM-368 as a site that required additional review. NRC Region I staff reviewed the file and determined that further information on the radiological status of this site was necessary. Region I staff conducted a safety inspection in May 1996, which included radiological survey activities in Buildings 3H and 6H where radioactive materials were used. Some facility areas, having the potential for residual contamination, were not readily accessible for survey during the May 1996 site visit. These areas included the decontamination pit, hot waste pipe trenches, subfloor soils, and drains that lead to the city storm and sanitary sewer system.

As a result of UNC's 1976 subfloor soil data and the inaccessibility of potentially contaminated areas during the May 1996 NRC inspection, the NRC Region I Office requested that the Environmental Survey and Site Assessment Program (ESSAP) of Oak Ridge Institute for Science and Education (ORISE) perform a radiological scoping survey of suspect areas of Buildings 3H and 6H, and the associated storm/sanitary sewer system, at the Former UNC H-Tract Facility in New Haven, Connecticut.

SITE DESCRIPTION

The UNC H-Tract facility is located at 71 Shelton Avenue in the west section of Science Park industrial park in northwest New Haven, Connecticut (Figure 1). The former H-Tract area is generally bounded by Division Street on the north, Shelton Avenue on the west, and the Winchester Gun Company on the east. The former 3H and 6H contiguous building is adjacent to Argyle Street to the south. The associated storm/sanitary sewer system included in this survey runs along the center line of Argyle Street (Figure 2).

The 3H and 6H building is a large one-story structure which is currently being used as a warehouse by a private citizen. Construction is mainly concrete floors and block or brick walls. Building 3H housed the initial fuel fabrication operations before a portion of the building between columns 33 and 39 was decontaminated and a concrete cap poured on the production floor. The concrete cap was removed prior to final survey activities (UNC 1976). Floor corings performed by ESSAP indicated that two distinct layers of concrete floor still remain. Building 6H housed the chemistry laboratories and the component assembly area. Clad fuel machining and non-fuel machining operations were also performed in 6H. Figure 3 shows the floor plan of Buildings 3H and 6H. The remaining buildings from the original decontamination efforts have since been demolished.

The areas of concern for this scoping survey, the decontamination trench and the hot waste pipe trenches, have been filled with concrete. One pipe trench, running the length of the building along the south wall, was not filled. Much of the buildings floor space in areas of concern was inaccessible due to storage by the current occupant.

OBJECTIVES

The objectives of the radiological scoping survey were to provide independent document reviews and radiological data for use by the NRC in evaluating the radiological conditions as compared to the current NRC guidelines for release for unrestricted use.

PROCEDURES

During the period of September 16 and 17, 1996, ESSAP performed a radiological scoping survey of portions of Buildings 3H and 6H and the associated storm/sewer system of the former UNC H-Tract facility in New Haven, Connecticut. The survey was performed in accordance with a survey plan dated September 10, 1996 which was submitted to and approved by the NRC Region I Office (ORISE 1996) and with the ORISE/ESSAP Survey Procedures and Quality Assurance Manuals (ORISE 1995a and b). Due to the difficulty in removing the two layers of concrete floor at some core locations, the survey plan was altered by ESSAP and a reduced number of subfloor soil samples were collected. It should be noted that the total thickness of concrete flooring was

approximately 30 cm. Additionally, at the request of the NRC site representative, the scope of the plan was altered to best fit the needs of the survey. This alteration consisted of collecting residue samples from the open pipe trench on the south side of the building rather than collecting residue samples from open drains. This report summarizes the procedures and results of the survey.

SURVEY PROCEDURES

Reference System

Sampling locations were referenced to prominent building features and recorded on appropriate maps.

Surface Scans

Surface scans for gamma radiation were performed over accessible floor space in all areas of concern. Scans for beta radiation were performed at the openings of accessible floor drains. Scans were performed using NaI scintillation and GM detectors coupled to ratemeters or ratemeter-scalers with audible indicators. Locations of elevated direct radiation identified by surface scans were marked for further investigation.

Soil Sampling

Background soil concentrations determined from a previous ESSAP survey site in the vicinity were used for comparison with NRC guidelines (ORISE 1993).

A total of five subfloor soil samples were collected from three floor core locations in Building 3H, two in the X-ray Reading Room and one in the decontamination pit area (Figure 3). At each location the floor was cored, a gamma radiation measurement was performed, and the soil directly beneath the concrete was sampled to 15 cm using a manual auger. If a post-sample gamma measurement indicated an increase in activity, a second sample was collected from 15 cm to 30 cm. This process

Room required sampling to 45 cm, the other two cores required sampling of only the first 15 cm of soil.

Miscellaneous Sampling

ESSAP collected two residue samples from the open pipe trench running along the south wall of the building—one from the Rectifier Room in Building 3H and one from the Chemistry Laboratory in Building 6H (Figure 3). Additionally, two sediment samples were collected from the storm/sewer system from manholes on Argyle Street (Figure 4).

SAMPLE ANALYSIS AND DATA INTERPRETATION

Samples were returned to ORISE's ESSAP laboratory in Oak Ridge, Tennessee for analysis and interpretation. Sample analysis was performed in accordance with the ORISE/ESSAP Laboratory Procedures Manual (ORISE 1995c). Soil and residue samples were initially analyzed by solid state gamma spectrometry. The radionuclides of interest were Th-232, U-235, and U-238; however, spectra were reviewed for other identifiable photopeaks. Based on the results of gamma spectrometry, four samples were also analyzed by alpha spectrometry to determine isotopic uranium abundances. Soil and residue sample results were reported in units of picocuries per gram (pCi/g). The data generated were compared with the NRC guidelines established for release for unrestricted use.

FINDINGS AND RESULTS

SURFACE SCANS

Gamma surface scans identified two locations of elevated direct radiation on the floor in the X-ray Reading Room of Building 3H. Direct radiation at these locations was approximately three times ambient background levels; both locations were confined to an area of about 300 cm². Note that borehole #1 (Table 1) was selected at one of these locations of elevated direct radiation. Beta scans of accessible floor drains did not identify any locations of elevated direct radiation.

RADIONUCLIDE CONCENTRATIONS IN SOIL

Radionuclide concentrations in subfloor soil samples are summarized in Table 1. Uranium concentrations for the five soil samples ranged from <0.2 to 25.6 pCi/g for U-235, <0.7 to 2.5 pCi/g for U-238, and <6.3 to 723 pCi/g for total uranium. Isotopic uranium results indicate that the contamination is enriched uranium. Background concentrations of total uranium in soil collected by ESSAP during a previous survey in the vicinity ranged from 3.2 to 5.6 pCi/g (ORISE 1993). Total thorium concentrations ranged from 1.0 to 2.2 pCi/g in the subfloor soil samples.

RADIONUCLIDE CONCENTRATIONS IN MISCELLANEOUS SAMPLES

Radionuclide concentrations in residue samples collected from the open trench and from two storm/sewer manholes are summarized in Table 2. Concentrations ranged from 0.1 to 7.7 pCi/g for U-235, from <0.7 to 7.7 pCi/g for U-238, and from 3.0 to 217 pCi/g for total uranium. Total thorium concentrations ranged from <0.7 to 2.2 pCi/g.

COMPARISON OF RESULTS WITH GUIDELINES


The NRC guidelines for residual concentrations of thorium and uranium wastes in soil, established for license termination of a facility for unrestricted use are presented in Appendix C. The primary contaminants for this site are enriched and depleted uranium and thorium. The Option 1 average soil guideline for enriched uranium is 30 pCi/g. The guideline for total thorium (Th-232 + Th-228) is 10 pCi/g.

Six samples collected by ESSAP exceeded the guideline for total uranium. These included the three subfloor soil samples from the X-ray Reading Room, borehole 1, the residue samples collected from the Rectifier Room pipe trench in Building 3H, the residue sample from the Chemistry lab trench in Building 6H, and the sediment sample collected from manhole 3 of the storm/sewer system. All total thorium concentrations were less than the guideline limits.

SUMMARY

During the period September 16 and 17, 1996, at the request of the NRC Region I Office, the Environmental Survey and Site Assessment Program of ORISE performed a radiological scoping survey of Buildings 3H and 6H, and the associated storm/sewer system at the Former UNC H-Tract Facility in New Haven, Connecticut. The survey activities consisted of gamma scans, subfloor soil sampling, residue sampling, and sediment sampling from the storm/sewer system.

Samples collected from each area of concern—subfloor soil, trench residue, and manhole sediment—indicated the presence of enriched uranium that exceeds the established NRC guidelines for total uranium. Total thorium concentrations were all less than the guideline limits.

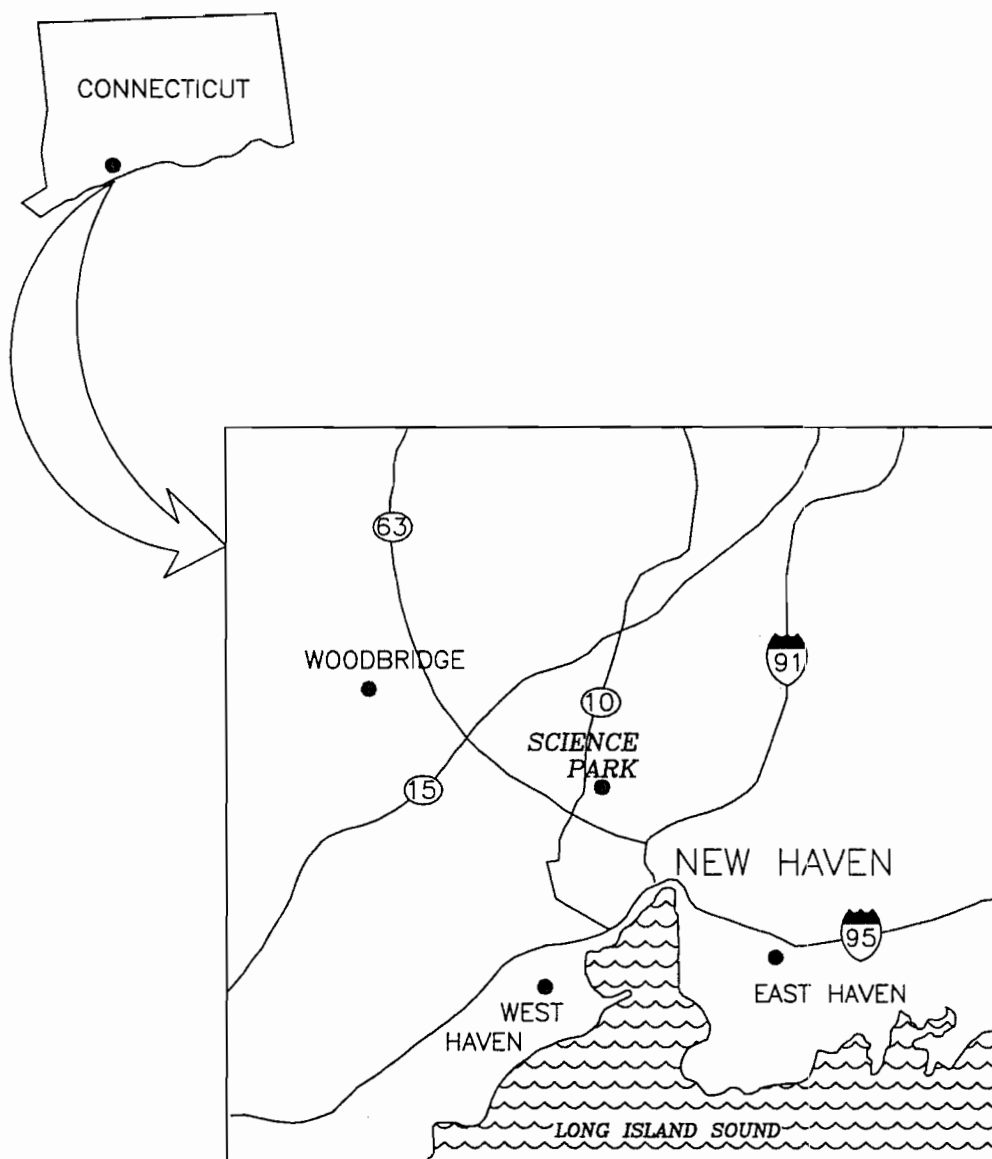

NOT TO SCALE

FIGURE 1: New Haven, Connecticut – Location of Science Park



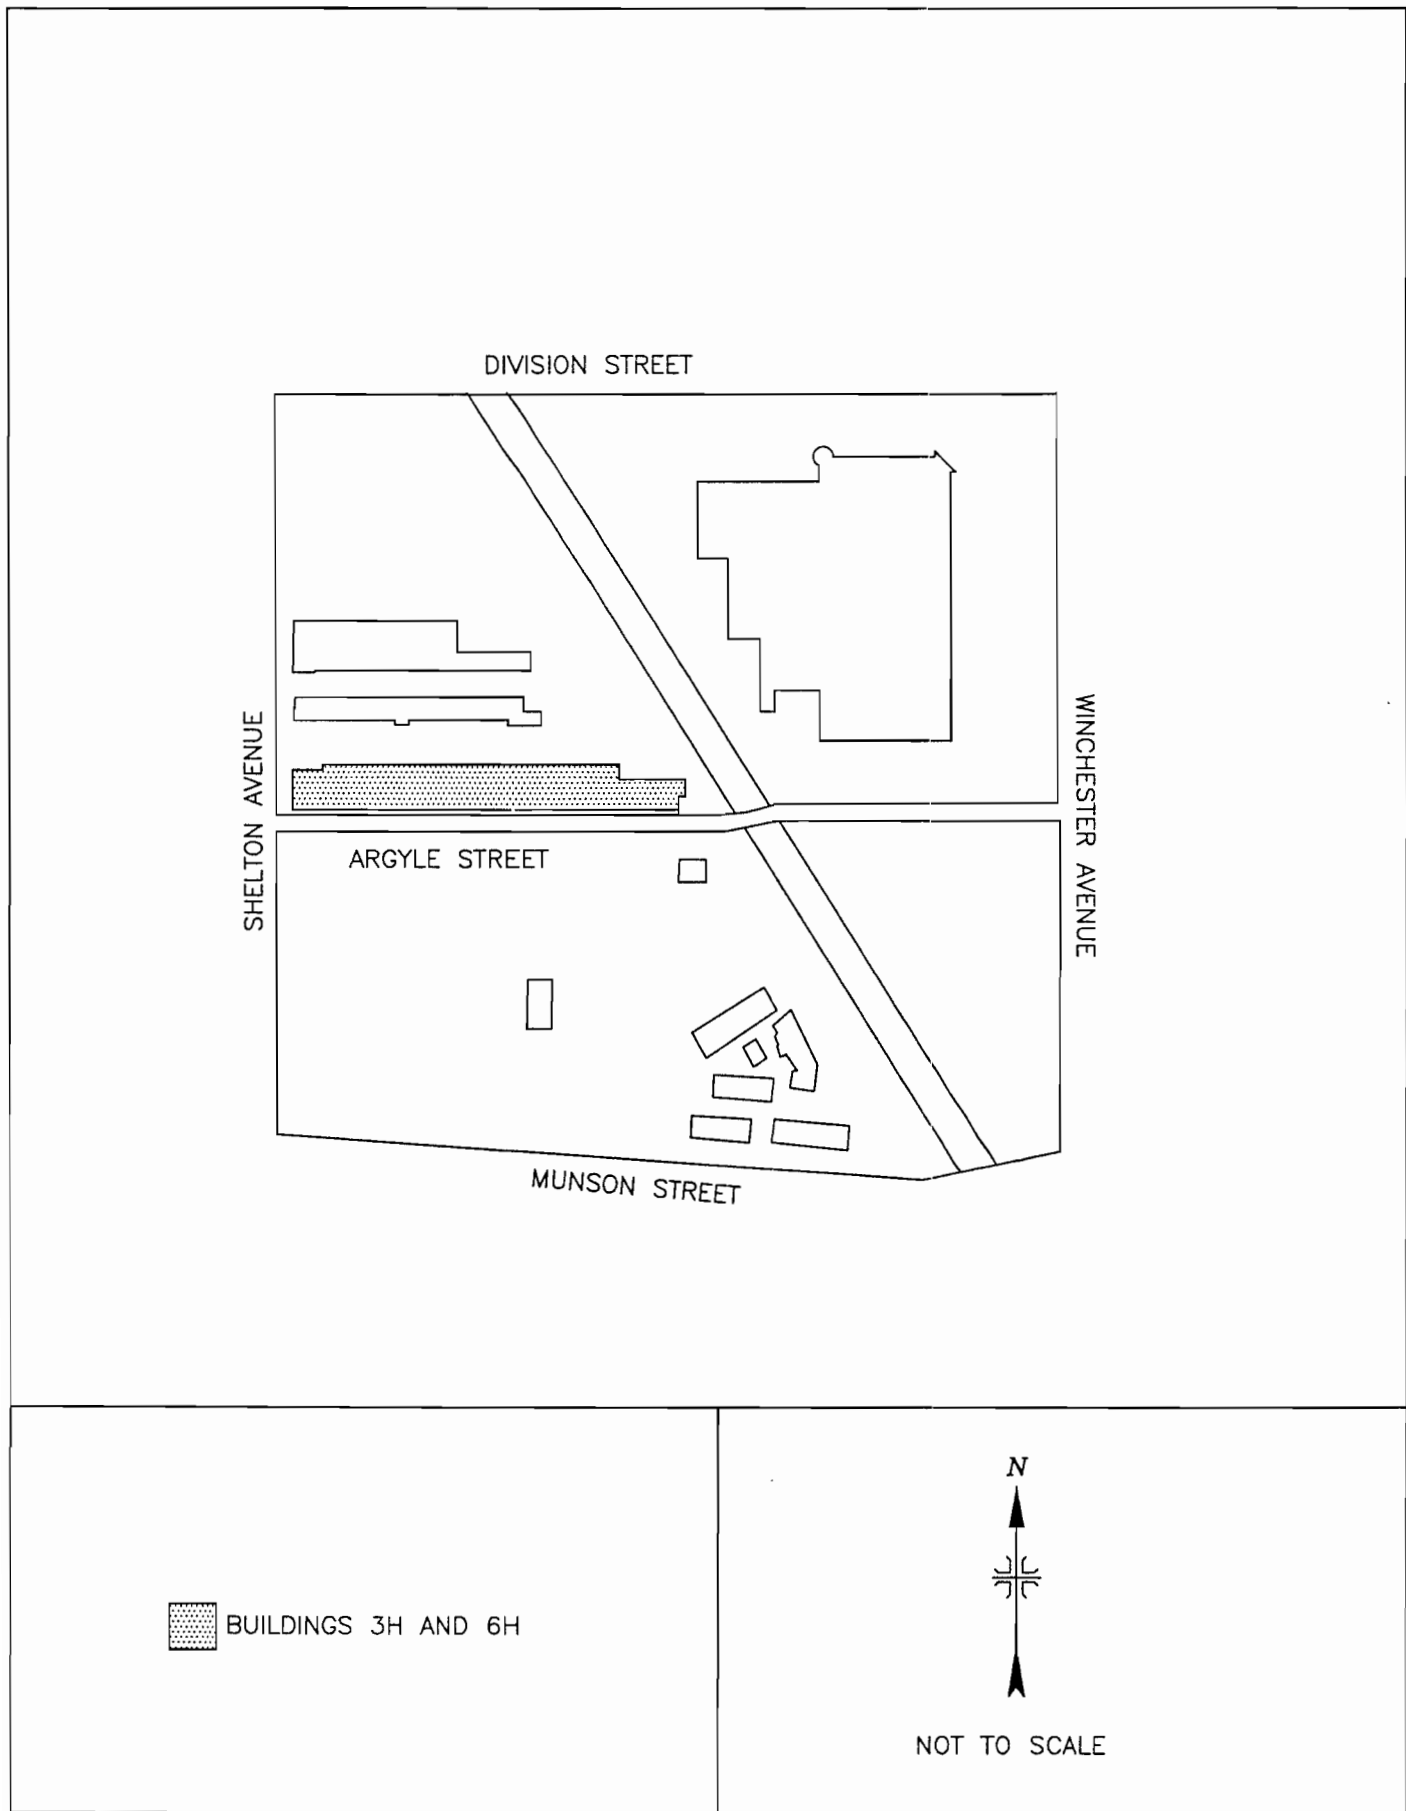





FIGURE 2: Layout of Science Park – Location of Buildings 3H and 6H

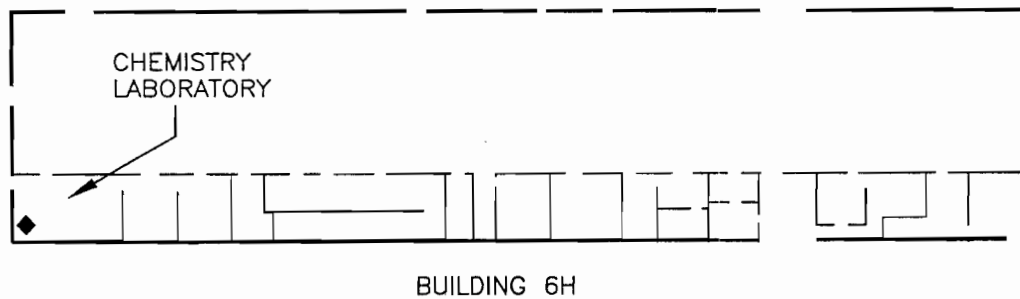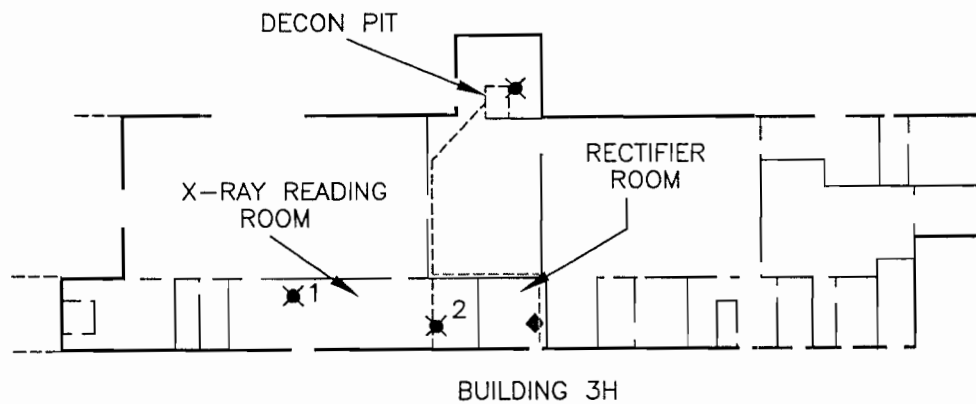

MEASUREMENT/SAMPLING LOCATIONS

-  # SUBFLOOR SOIL
-  RESIDUE

 FORMERLY EXCAVATED TRENCH



NOT TO SCALE

FIGURE 3: Floor Plan of Buildings 3H and 6H – Sampling Locations

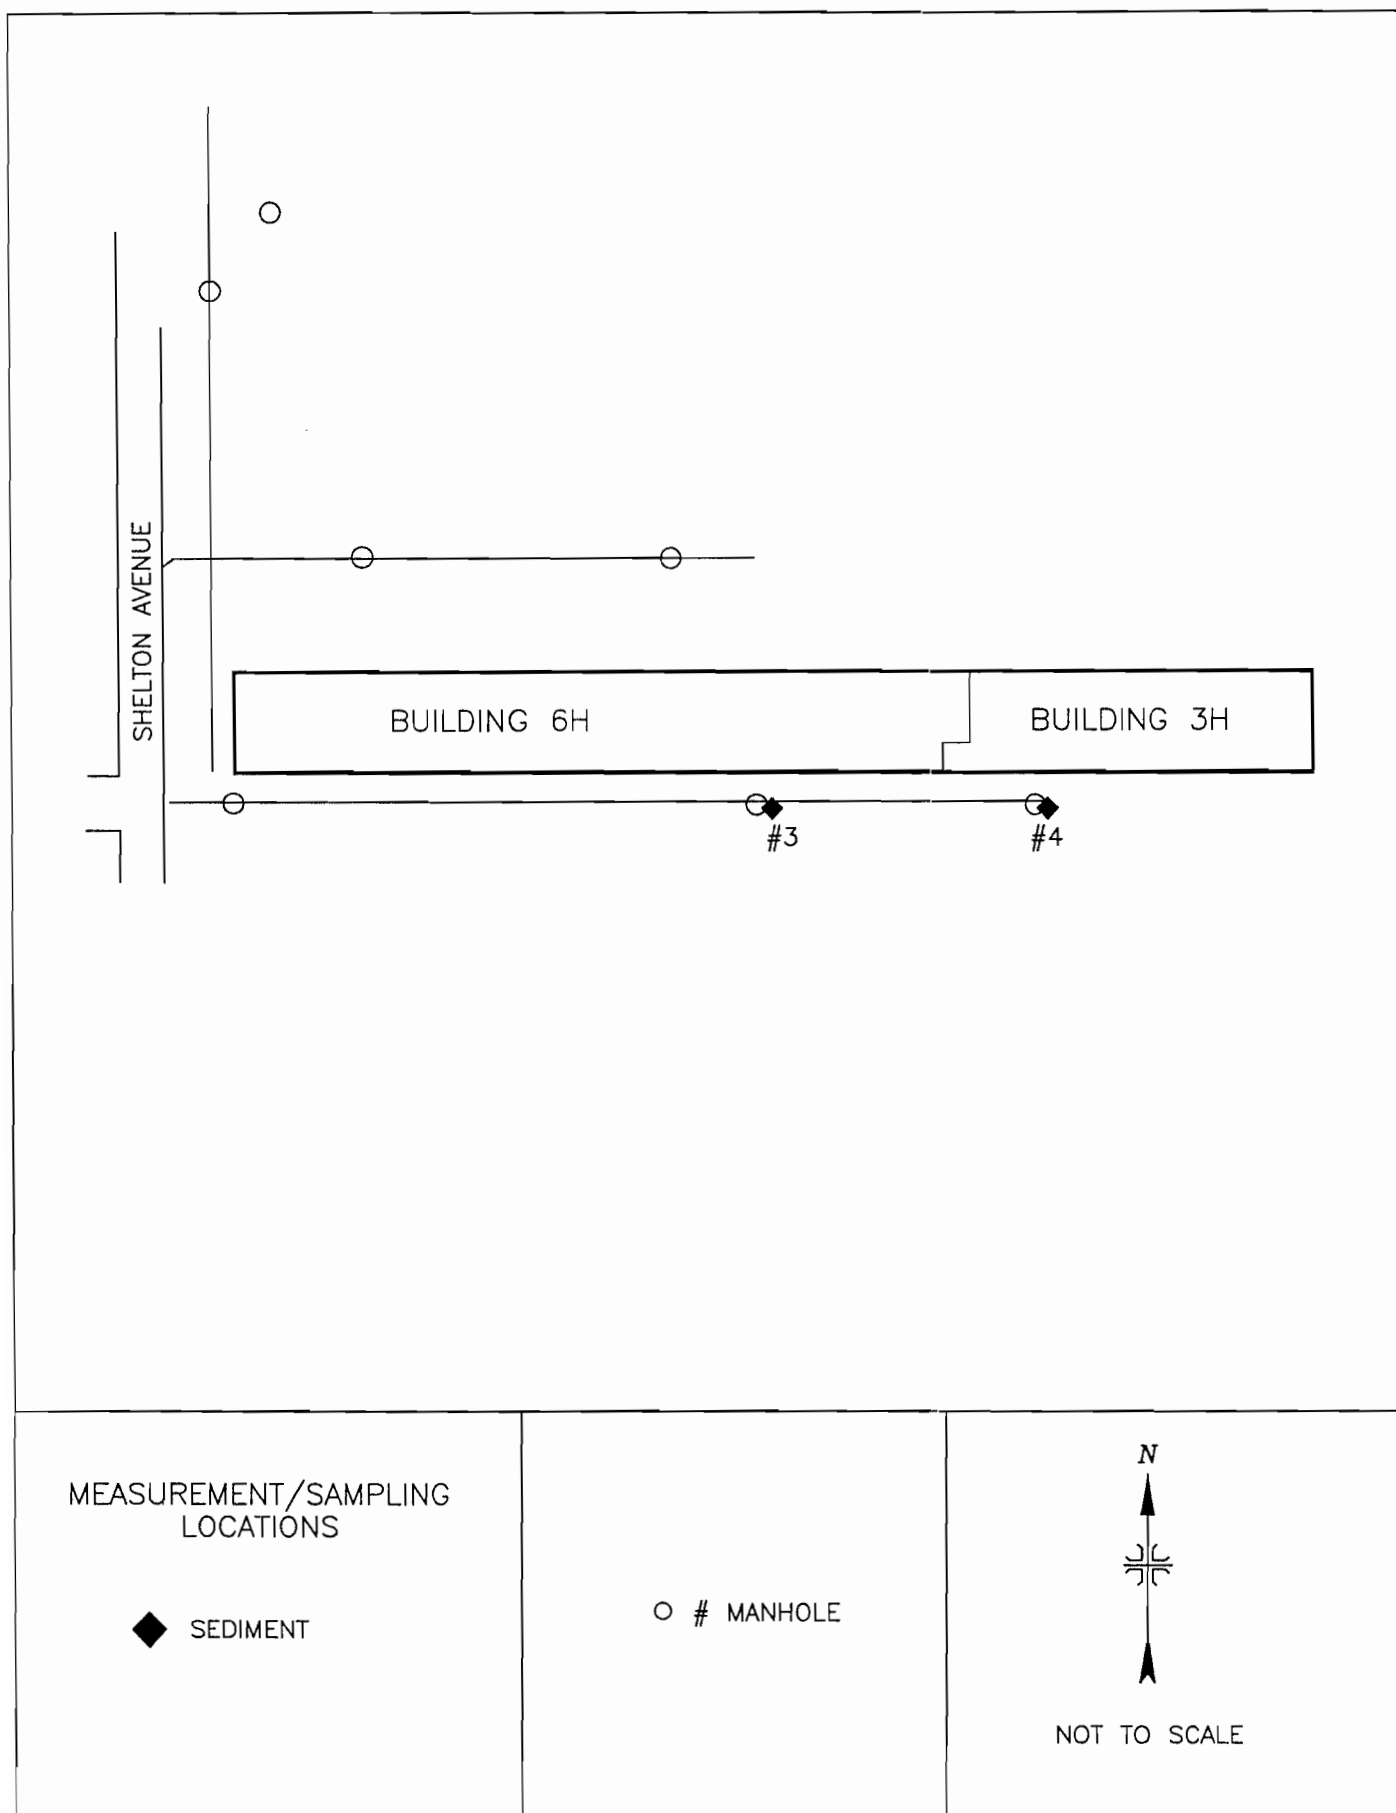


FIGURE 4: Layout of Storm/Sewer System – Sampling Locations

TABLE 1

**RADIONUCLIDE CONCENTRATIONS IN SUBFLOOR SOIL SAMPLES
BUILDING 3H OF THE
FORMER UNC H-TRACT FACILITY
NEW HAVEN, CONNECTICUT**

Location ^a /Depth	Radionuclide Concentration (pCi/g)				
	U-234	U-235	U-238	Total Uranium	Total Thorium ^b
Decontamination Pit					
0 - 15 cm	NA ^c	<0.2	0.7 ± 0.5 ^d	<6.3 ^e	2.2
X-ray Reading Room Borehole #1					
0 - 15 cm	695 ± 46 ^f	25.6 ± 1.9 ^f	2.5 ± 0.3 ^f	723 ± 46 ^f	1.0
15 - 30 cm	221 ± 15 ^f	7.9 ± 0.7 ^f	1.0 ± 0.2 ^f	230 ± 15 ^f	1.8
30 - 45 cm	NA	3.2 ± 0.3	<0.7	90 ^d	1.4
X-ray Reading Room Borehole #2					
0 -15 cm	NA	0.1 ± 0.1	0.4 ± 0.3	3.2 ^e	1.0

^aRefer to Figure 3.

^bTotal thorium was calculated by adding the Th-232 and Th-228 concentrations.

^cNA = not applicable.

^dUncertainties represent the 95% confidence level, based only on counting statistics.

^eTotal uranium concentrations for gamma spectrometry results were calculated based on a U-234 to U-235 activity ratio of 27 (based on alpha spectrometry results).

^fUranium results from alpha spectrometry analysis.

TABLE 2

**RADIONUCLIDE CONCENTRATIONS IN MISCELLANEOUS SAMPLES
FROM THE
FORMER UNC H-TRACT FACILITY
NEW HAVEN, CONNECTICUT**

Location ^a	Radionuclide Concentration (pCi/g)				
	U-234	U-235	U-238	Total Uranium	Total Thorium ^b
Building 3H					
Rectifier Room Trench	NA ^c	1.3 ± 0.2 ^d	<0.7	37 ^e	1.6
Building 6H					
Chemistry Lab Trench	54.2 ± 3.9 ^f	2.1 ± 0.2 ^f	1.0 ± 0.2 ^f	57.3 ± 3.9 ^f	1.0
Storm/Sewer System					
Manhole #3	203 ± 15 ^f	7.7 ± 0.8 ^f	7.7 ± 0.7 ^f	217 ± 15 ^f	2.2
Manhole #4	NA	0.1 ± 0.1	0.2 ± 0.4	3.0 ^e	<0.7

^aRefer to Figures 3 and 4.

^bTotal thorium calculated by adding the Th-232 and Th-228 concentrations.

^cNA = not applicable.

^dUncertainties represent the 95% confidence level, based only on counting statistics.

^eTotal uranium concentrations for gamma spectrometry results were calculated based on a U-234 to U-235 activity ratio of 27 (based on alpha spectrometry results).

^fUranium results from alpha spectrometry analysis.

REFERENCES

Oak Ridge Institute for Science and Education (ORISE). Confirmatory Survey of Building B-South Roof, Building L Support Areas, Pumphouse South and Septic Tank, and the Unaffected Outdoor Areas, UNC Naval Products, Montville, Connecticut. Oak Ridge, Tennessee; December 1993.

Oak Ridge Institute for Science and Education. Survey Procedures Manual for the Environmental and Health Sciences Division, Environmental Survey and Site Assessment Program, Revision 9. Oak Ridge, Tennessee; April 30, 1995a.

Oak Ridge Institute for Science and Education. Quality Assurance Manual for the Environmental and Health Sciences Division, Environmental Survey and Site Assessment Program, Revision 9. Oak Ridge, Tennessee; January 31, 1995b.

Oak Ridge Institute for Science and Education. Laboratory Procedures Manual for the Environmental and Health Sciences Division, Environmental Survey and Site Assessment Program, Revision 9. Oak Ridge, Tennessee; January 31, 1995c.

Oak Ridge Institute for Science and Education. Scoping Survey Plan for the Former UNC Facility Buildings 3H and 6H, New Haven, Connecticut (Docket No. 70-371; RFTA No. 96-37). Oak Ridge, Tennessee; September 10, 1996.

United Nuclear Corporation (UNC). Final Survey Report after Decontamination. United Nuclear Corporation Naval Products Division H-Tract Facility. New Haven, Connecticut; February 1976.

U.S. Nuclear Regulatory Commission (NRC). Inspection No. 070-00371/96-01. July 26, 1996.

APPENDIX A

MAJOR INSTRUMENTATION

APPENDIX A

MAJOR INSTRUMENTATION

The display of a specific product is not to be construed as an endorsement of the product or its manufacturer by the author or his employers.

DIRECT RADIATION MEASUREMENT

Instruments

Eberline Pulse Ratemeter
Model PRM-6
(Eberline, Santa Fe, NM)

Ludlum Ratemeter-Scaler
Model 2221
(Ludlum Measurements, Inc.,
Sweetwater, TX)

Detectors

Eberline GM Detector
Model HP-260
Effective Area, 20 cm²
(Eberline, Santa Fe, NM)

Victoreen NaI Scintillation Detector
Model 489-55
3.2 cm x 3.8 cm Crystal
(Victoreen, Cleveland, OH)

LABORATORY ANALYTICAL INSTRUMENTATION

Alpha Spectrometry System
Tennelec Electronics Model
(Tennelec, Oak Ridge, TN)
Used in conjunction with:
Surface Barrier and Ion Implanted Alpha Detectors
(EG&G ORTEC, Oak Ridge, TN) and
Multichannel Analyzer
3100 Vax Workstation
(Canberra, Meriden, CT)

High Purity Extended Range Intrinsic Detectors

Model No: ERVDS30-25195

(Tennelec, Oak Ridge, TN)

Used in conjunction with:

Lead Shield Model G-11

(Nuclear Lead, Oak Ridge, TN) and

Multichannel Analyzer

3100 Vax Workstation

(Canberra, Meriden, CT)

APPENDIX B

SURVEY AND ANALYTICAL PROCEDURES

APPENDIX B

SURVEY AND ANALYTICAL PROCEDURES

SURVEY PROCEDURES

Surface Scans

Surface scans were performed by passing the detectors slowly over the surface; the distance between the detector and the surface was maintained at a minimum—nominally about 1 cm. Identification of elevated levels was based on increases in the audible signal from the recording and/or indicating instrument. Combinations of detectors and instruments used for the scans were:

Beta - GM detector with ratemeter-scaler

Gamma - NaI scintillation detector with ratemeter

Soil, Sediment, and Residue Samples

Approximately 1 kg of material was collected at each sample location. Collected samples were placed in a plastic bag, sealed, and labeled in accordance with ESSAP survey procedures.

ANALYTICAL PROCEDURES

Miscellaneous Samples

Samples of soil, sediment, and residue were dried, mixed, crushed, and/or homogenized as necessary, and a portion sealed in 0.5-liter Marinelli beaker or other appropriate container. The quantity placed in the beaker was chosen to reproduce the calibrated counting geometry. Net material weights were determined and the samples counted using intrinsic germanium detectors coupled to a pulse height analyzer system. Background and Compton stripping, peak search, peak identification, and concentration calculations were performed using the computer capabilities inherent in the analyzer system.

All photopeaks associated with the radionuclides of concern were reviewed for consistency of activity. Energy peaks used for determining the activities of radionuclides of concern were:

Th-228	0.238 MeV from Pb-212*
Th-232	0.911 MeV from Ac-228*
U-235	0.144 MeV
U-238	0.063 MeV from Th-234*

*Secular equilibrium assumed.

Spectra were also reviewed for other identifiable photopeaks.

ALPHA SPECTROMETRY

Solid Samples

Solid, soil, sludge and miscellaneous samples (debris, residues, tile, etc.) were crushed, homogenized and analyzed for isotopic uranium. Samples were dissolved by potassium fluoride and pyrosulfate fusion and the elements of interest were precipitated with barium sulfate. Barium sulfate precipitate was redissolved and the specific elements of interest were individually separated by liquid-liquid extraction and re-precipitated with a cerium fluoride carrier. The precipitate was then counted using surface barrier and ion implanted detectors (ORTEC), alpha spectrometers (Tennelec and Canberra), and a multichannel analyzer (Nuclear Data).

UNCERTAINTIES AND DETECTION LIMIT

The uncertainties associated with the analytical data presented in the tables of this report represent the 95% confidence level for that data. These uncertainties were calculated based on both the gross sample count levels and the associated background count levels. Additional uncertainties, associated with sampling and measurement procedures, have not been propagated into the data presented in this report.

Detection limits, referred to as minimum detectable concentration (MDC), were based on 2.71 plus 4.65 times the standard deviation of the background count $[2.71 + (4.65\sqrt{\text{BKG}})]$. When the activity was determined to be less than the MDC of the measurement procedure, the result was reported as less than MDC. Because of variations in background levels, measurement efficiencies, and contributions from other radionuclides in samples, the detection limits differ from sample to sample and instrument to instrument.

CALIBRATION AND QUALITY ASSURANCE

Calibration of all field and laboratory instrumentation was based on standards/sources, traceable to NIST, when such standards/sources were available. In cases where they were not available, standards of an industry recognized organization were used.

Analytical and field survey activities were conducted in accordance with procedures from the following documents of the Environmental Survey and Site Assessment Program:

- Survey Procedures Manual, Revision 9 (April 1995)
- Laboratory Procedures Manual, Revision 9 (January 1995)
- Quality Assurance Manual, Revision 7 (January 1995)

The procedures contained in these manuals were developed to meet the requirements of DOE Order 5700.6C and ASME NQA-1 for Quality Assurance and contain measures to assess processes during their performance.

Quality control procedures include:

- Daily instrument background and check-source measurements to confirm that equipment operation is within acceptable statistical fluctuations.
- Participation in EPA and EML Laboratory Quality Assurance Programs.
- Training and certification of all individuals performing procedures.
- Periodic internal and external audits.

APPENDIX C

GUIDELINES FOR RESIDUAL CONCENTRATIONS OF THORIUM AND URANIUM WASTES IN SOIL

APPENDIX C

GUIDELINES FOR RESIDUAL CONCENTRATIONS OF THORIUM AND URANIUM WASTES IN SOIL

On October 23, 1981, the Nuclear Regulatory Commission published in the Federal Register a notice of Branch Technical Position on "Disposal or Onsite Storage of Thorium and Uranium Wastes from Past Operations." This document establishes guidelines for concentrations of uranium and thorium in soil, that will limit maximum radiation received by the public under various conditions of future land usage. These concentrations are as follows:

Material	Maximum Concentrations (pCi/g) above background for various options			
	1 ^a	2 ^b	3 ^c	4 ^d
Natural Thorium (Th-232 + Th-228) with daughters present and in equilibrium	10	50	---	500
Natural Uranium (U-238 + U-234) with daughters present and in equilibrium	10	--	40	200
Depleted Uranium:				
Soluble	35	100	---	1,000
Insoluble	35	300	---	3,000
Enriched Uranium:				
Soluble	30	100	---	1,000
Insoluble	30	250	---	2,500

^aBased on EPA cleanup standards which limit radiation to 1 mrad/yr to lung and 3 mrad/yr to bone from ingestion and inhalation and 10 μ R/h above background from direct external exposure.

^bBased on limiting individual dose to 170 mrem/yr.

^cBased on limiting equivalent exposure to 0.02 working level or less.

^dBased on limiting individual dose to 500 mrem/yr and in case of natural uranium, limiting exposure to 0.02 working level or less.