



**Entergy  
Operations**

Entergy Operations, Inc.  
P.O. Box B  
Kilbuck, LA 70066  
Tel 504-739-6650

W3B5-91-0116  
A4.05  
QA

April 19, 1991

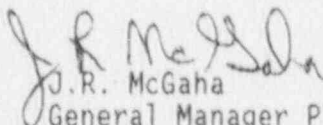
U.S. Nuclear Regulatory Commission  
ATTENTION: Document Control Desk  
Washington, D.C. 20555

SUBJECT: Waterford 3 SES  
Docket No. 50-382  
License No. NPF-38  
Reporting of Special Report

Gentlemen:

Attached is Special Report Number SR-91-003-00 for Waterford Steam Electric Station Unit 3. This Special Report is submitted per 10CFR50.36(c)(2) and Technical Specifications 4.4.4.5.b and 6.9.2.

Very truly yours,

  
J.R. McGaha

General Manager Plant Operations

JRM/WEF/rk  
Attachment

cc: Messrs. R.D. Martin  
G.L. Florreich  
J.T. Wheelock - INPO Records Center  
E.L. Blake  
D.L. Wigginton  
N.S. Reynolds  
NRC Resident Inspectors Office

9104240132 910419  
PDR ADDCK 05000302  
S PDR

TE22  
ADD 11

SPECIAL REPORT

SR-91-003-00

Steam Generator Eddy Current Examination  
(4th Refueling)

Inservice Eddy Current examination of the Steam Generator (SG) tubing was completed at Waterford Steam Electric Station Unit 3 on April 6, 1991. This report is submitted in accordance with Technical Specification (TS) 4.4.4.5.a, which requires reporting the number of tubes plugged in each SG within 15 days of completing Inservice Inspection (ISI) of SG tubes pursuant to TS 6.9.2. A follow-up report will be submitted in accordance with TS 4.4.4.5.b by April 6, 1992.

The total number of tubes which have been plugged in each SG are shown below:

	<u>SG #1</u>	<u>SG #2</u>
Manufacturing/Preservice	6	20
Batwing (Preventive Plugging)	149	149
First Refueling	0	1
Second Refueling	3	0
Third Refueling	10	9
Fourth Refueling		
- Preventive Plugging As A Result of ECT	4	5
- Batwing Preventive Plugging	<u>156</u>	<u>156</u>
TOTAL	328	340

PLANT CONTACT

J.E. Howard, Procurement/Programs Engineering Manager (504) 739-6327